

# CP11

## SHORT INSTRUCTION MANUAL


Congratulations on your purchase of the new portable humidity, temperature and CO<sub>2</sub> instrument. Please read these short instruction carefully before installing the device.

### General description

The CP11 is an accurate hand-held datalogger that displays & records relative humidity, temperature, CO<sub>2</sub> and calculated parameters such as dew point and wet bulb. These short instructions are limited to a description of the main functions and installation of the device. The detailed instruction manual can be found on the internet at [www.rotronic-humidity.com](http://www.rotronic-humidity.com)

### Programming

Most of the settings, such as memory clear, CO<sub>2</sub> alarm, units(°C/°F), sampling rate, pressure compensation and real time clock can be changed using the function keys.

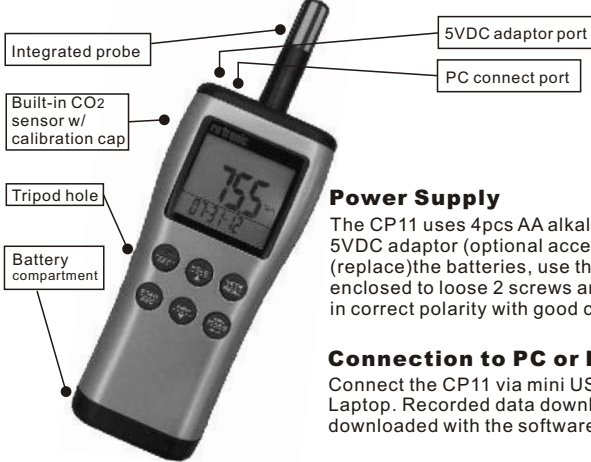


### Power Supply

The CP11 uses 4pcs AA alkaline batteries or 5VDC adaptor (optional accessory). To insert (replace)the batteries, use the screw driver enclosed to loose 2 screws and put in the batteries in correct polarity with good contact.


### Connection to PC or Laptop

Connect the CP11 via mini USB cable to a PC or Laptop. Recorded data download can be easily downloaded with the software enclosed.

### Functions Key

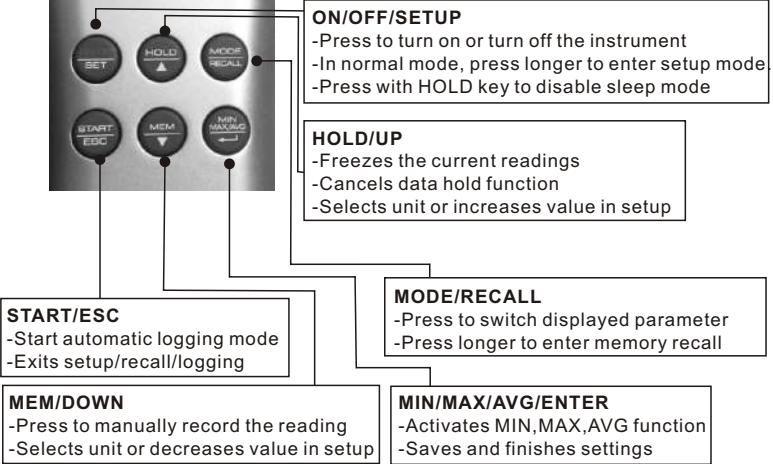

### Display

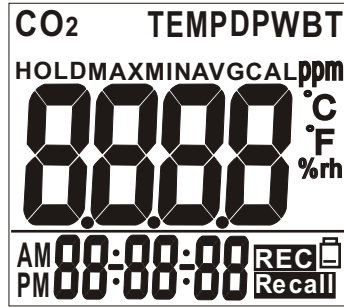



|                 |                                           |
|-----------------|-------------------------------------------|
| UpperLCD        | Humidity/TEMP/CO <sub>2</sub> ....reading |
| LowerLCD        | Real time clock display                   |
| CO <sub>2</sub> | Carbon dioxide reading                    |
| HOLD            | Readings are hold unchanged               |
| MIN/MAX         | Minimum/Maximum readings                  |
| AVG             | Average reading                           |
| ☹               | Low battery indicator                     |
| DP              | Dew point temperature                     |
| TEMP            | Temperature                               |
| WBT             | Wet bulb temperature                      |
| %rh             | Unit of relative humidity                 |
| °C/°F           | Celsius/Fahrenheit of temperature         |
| CAL             | In calibration status                     |
| REC             | In manual/automatic logging status        |
| RECALL          | In manual records recall mode             |

### Operation

#### POWER ON/OFF

Press to turn the meter on. At power up, it emits a short beep and per-forms 28 sec. countdown (Fig.1) for meter warm up, then enters normal mode with real time clock displayed (Fig.2). Date and time are displayed in turns.

To power off, press again to turn off the meter.

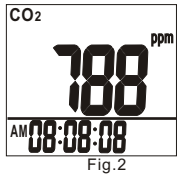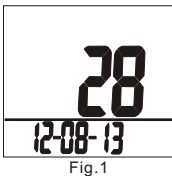

#### DATE/TIME SETUP

When meter is powered on , hold down for more than 2 seconds until entering meter setup mode. Press or key to select the program P80 (rtc) and press key to enter.

First, choose the time format as 12hour or 24hour by pressing or and then press to confirm. Second, choose the date format as Month-Day-Year or Day-Month-Year by pressing or and then, press key to confirm. Now, start to input the real time clock value from year, month, day, hour, minute to second. Press or to select and then press to confirm. Press to return to normal.

#### UNIT SETUP

When meter is powered on , hold down for more than 2 seconds until entering meter setup mode. Press or key to select the program P50 (unit) and press key to enter.

Press or to select °C or °F and then press to confirm. Press to return to normal.

#### TAKING MEASUREMENT

The meter starts measurement when power on and update readings every second. In the condition of operating environment change, it takes 30 seconds to respond for CO<sub>2</sub> sensor.

**NOTE: Do not hold the meter close to faces in case exhalation affects CO<sub>2</sub>**

#### Humidity

Press to switch to humidity display.(Fig.3).The lower display shows the real time clock.

#### TEMP,DP,WBT

Press to switch to temperatures display(Fig.4,5,6). The lower display shows the real time clock.

#### CO<sub>2</sub> (Carbon Dioxide)

Press to switch the mode to CO<sub>2</sub>.User can get the CO<sub>2</sub> reading in ppm unit on main display.(Fig.7). The lower display shows the real time clock.

#### DATA HOLD

In normal display mode, press to freeze the readings, "HOLD" icon is flashed on the left top of LCD (Fig.8). All current readings are kept unchanged. Press again to cancel the hold function.

**NOTE:**  
The hold function is disabled in Min/Max/Avg mode.

#### BACKLIGHT

The backlight will be activated for 10 seconds by pressing any key.

#### MIN,MAX,AVG,CURRENT REVIEW






This meter allows you to check the minimun, maximum, average, current value from the moment you press the key. Under normal mode, each press of displays MIN, MAX, AVG and current value in sequence. (Fig.9~11). To return to normal mode, press to escape(Fig.12)

In this max/min/avg/current modes, it shows the corresponding readings on main display and the **accumulated time** of how long you are in this mode. The maximum time interval for this function is 18 hours.

Press can switch the displayed parameters. (Fig.13)

Distinguishing the normal display and current review by checking the time display format. In normal display, date & time are displayed in turns. In current review, the lower display is the **accumulated time** of how long you are in max/min/avg mode.

**NOTE:**  
“HOLD” & “MANUALLY RECORD” & “RECALL” functions are disabled in Min/Max/Avg mode.

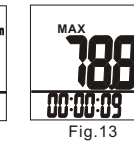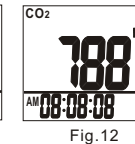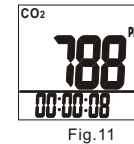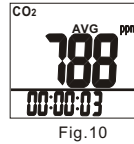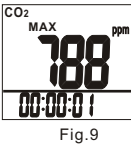


#### ALARM

The meter features audible alarm to give warnings when CO<sub>2</sub> concentration exceeds the limit. (See “Meter Setup” section for setting alarm threshold). It emits beeps (Abt. 80dB) when CO<sub>2</sub> level goes over the set value and stops only when the readings fall below the set value. It beeps again when value goes over the limit.

#### AUTO POWER OFF

The meter turns off automatically after 20 minutes of inactivity. To override the function, first, the meter is in power off status. Hold down and for 2 seconds to turn on the meter until “n” appears.(Fig.14)

**NOTE:**  
Auto sleep function will be disabled during calibration & auto recording mode. Auto sleep function WILL NOT be disabled automatically via using adaptor.


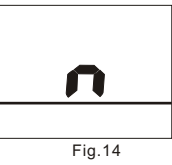


#### MANUALLY RECORDING

The meter features a 99 point memory. In the normal or hold mode, press key to start recording, the **REC** icon and the main display will be flashed 3 times. The memory sequential number will show on the main display with 99 points in maximum. The data in the memory contains all parameters information and not only the displayed parameter. When all 99 points memory are occupied, a “FULL” message will be displayed on the screen. If you think the reading is changing too fast, you can press key to freeze current reading first then manually record the data. This recording function will be disabled in the Min/Max mode.

#### 99 MEMORIES RECALL

In normal or hold mode, press key for more than 2 seconds until the **Recall** icon flashes. Press or to scroll the memories. The memory sequential number displays on main LCD first and reading comes after. (Fig16&17). Press key to switch the display parameter.(Fig.18).The time displayed in memory recall mode is the recording time of this memory.

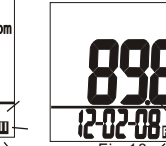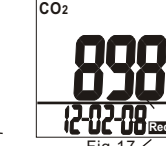

#### DATA LOGGING

The meter can automatically record Humidity/TEMP./CO<sub>2</sub> for long term environment monitor. The memory capacity is 6000 points for each parameter. Users can set up sampling rate from 1 second to 4hours 59 minutes and 59 seconds. The factory preset rate is 30 second.

To setup the sampling rate, when meter is powered on , hold down for more than 2 seconds until entering meter setup mode. Pres or key to select the program P60 (rAtE) and press key to enter.

Press or to select the sample rate from hour, minute to second and then press to confirm. Press to return to normal.

After sampling rate is selected, press for 2 seconds under normal mode to start logging. The **REC** icon flashes to indicate the logging status and LCD main display shows the real time value. Lower displays are real time clock. (Fig.19)

Repeat above to start another run of logging. While the logging space is full, it shows “FULL”. To terminate data logging, press for 2 seconds, **REC** icon stops flashing.

Press key to switch to the mode you want to see. Except the mode switching function, auto power off, min/max, manual record, hold and recall functions are all disabled during logging.

#### Meter Setup

When meter is powered on , hold down for more than 2 seconds until entering meter setup mode. To exit setup, press to return to normal mode.

Press or key to select the program and press key to select. The programmable setting flashes on display, press or key to select and press key to confirm. To leave without saving, press key to return.

|                                       |  |                                                                                    |
|---------------------------------------|--|------------------------------------------------------------------------------------|
| P10, 99 points MEMORY clear           |  | <b>Note:</b><br>“donE” is displayed while memory is cleared.                       |
| P11, choose yes or no                 |  |                                                                                    |
| P20, auto LOG data clear              |  | <b>Note:</b><br>“donE” is displayed while memory is cleared.                       |
| P21, choose yes or no                 |  |                                                                                    |
| P30, CO2 ALARM setup                  |  | <b>Note:</b><br>-Factory preset 1400ppm.<br>-Adjustable scale is every 100ppm      |
| P31, choose from 100 to 9900          |  |                                                                                    |
| P40, CO2 ABC setup                    |  | <b>Note:</b><br>-Factory preset ABC function as ON                                 |
| P41, Choose on or off                 |  |                                                                                    |
| P50, Temp. UNIT setup                 |  | <b>Note:</b><br>-Factory preset °C                                                 |
| P51, choose °C or °F                  |  |                                                                                    |
| P60, logging sampling RATE            |  | <b>Note:</b><br>-Factory preset at 30 sec.<br>-The format is hour:minute:second    |
| P61, choose from 04:59:59 to 00:00:01 |  |                                                                                    |
| P70, PRESSURE compensation            |  | <b>Note:</b><br>-Factory preset at 1013hpa<br>-The adjustable scale is every 1hpa. |
| P71, choose from 700 to 1990hpa       |  |                                                                                    |
| P80, REAL TIME CLOCK setup            |  | <b>Note:</b><br>-Factory preset at 12H & dd-mm-year format.                        |
| P81, choose 12 or 24 hour format      |  |                                                                                    |
| choose DATE format                    |  |                                                                                    |
| Input Year/ Month/ Day                |  | year month date 00 01 <-----> 99 01 31                                             |
| Input Hour/ Min./Sec.                 |  | Hour Minute Second 01 00 <-----> 24 59 59                                          |

#### Battery low indicator

A battery low icon “☹” appears when the supplied power is too low to maintain a normal operation. Please replace the batteries for accurate measuring. Suggest to use adaptor (optional part: AC1214) for long term measuring & datalogging.

#### Humidity Calibration

This meter can be calibrated either via 35% & 80% salt bottle or humidity generator. The ambient condition is recommended as stable 25°C. While the meter is powered off, plug the sensor probe into 35% salt. Press or simultaneously for 3 seconds to turn on the meter and enter calibration mode. Press or to select 35.0% calibration and press to start. “CAL” and calibrating value are blinking on the LCD.

**CAUTION:**  
Do not calibrate the humidity without the default calibration salt. Otherwise, it will cause permanent damage. Contact ROTRONIC for calibration salt or services.  
Single point calibration will cause error code E11 or non accurate reading. Always do dual point calibration to complete a process. Suggest to calibrate low humidity first.

#### CO<sub>2</sub> Calibration

The sensor has an automatic calibration function to secure long-term accuracy. If a calibration is desired, press or simultaneously for 3 seconds to turn on the meter and enter calibration mode. Press or key to select 400 ppm CO<sub>2</sub> calibration (Outside Air calibration). Press to start and see“CAL” and CO<sub>2</sub> value blinking on LCD. Wait about 10 minutes until the blinking stops and the calibration is completed and back to normal mode. While choose 0 ppm CO<sub>2</sub> calibration, remove the cap from meter rear side and plug the CO<sub>2</sub> CALIBRATOR pipe into the sensor hole beneath. Wait about 10 min until the blinking stops and the calibration is completed and back to normal mode.

**CAUTION:**  
Do not calibrate the meter in the air with unknown CO<sub>2</sub> concentration. Otherwise, it will be calibrated as 0 or 400ppm by default and leads to inaccurate measurements.  
Ensure the batteries are with full voltage during the calibration to prevent from interruption or failed calibration. When the accuracy becomes a concern after a long time usage, return to dealers for standard calibration.

#### Trouble Shooting

| Error | Messages                                           | Solution                          |
|-------|----------------------------------------------------|-----------------------------------|
| E01   | CO <sub>2</sub> sensor is out of order             | Turn off meter and re-start again |
| E33   | CO <sub>2</sub> sensor is out of order             | Retry CO <sub>2</sub> calibration |
| E02   | measured value is under range                      | Put meter in normal condition     |
| E03   | measured value is over range                       | Put meter in normal condition     |
| E04   | Original data error results in this error (DP, WB) | Solve the original data error     |
| E11   | RH calibration error                               | Retry humidity calibration        |
| E31   | Temp. sensor or AD damaged                         | Return for repair                 |
| E32   | Memory IC damaged                                  | Return for repair                 |
| E33   | RH sensor or circuit damaged                       | Return for repair                 |

#### Technical Data

|                                 |                                                                     |
|---------------------------------|---------------------------------------------------------------------|
| Humidity/accuracy:              | 0.1% to 99.9%/ ±3.0%(10~95% @25 °C), ±5% (other)                    |
| Temperature/accuracy:           | -20...60°C/±0.3°C@5~40°C                                            |
| CO <sub>2</sub> /accuracy:      | 0...9999ppm/±(30ppm+5% of reading)@0~5000ppm                        |
| Storage and transit:            | -20...60°C/10...90%rh, non condensing.                              |
| Operating limit at electronics: | 0...50°C for CO <sub>2</sub> , -20...60°C for rest/ non condensing. |
| Memory:                         | 99 records manually, 18000 records auto logging.                    |
| Dimensions:                     | 234(L)x77(W)x42(H),mm                                               |
| Weight:                         | 200gr.                                                              |
| Battery type:                   | 4pcs AA alkaline                                                    |
| DC power type:                  | 5VDC, 250mA. Optional available.                                    |
| PC connection:                  | mini USB port                                                       |

#### Optional Accessory

|                             | Part Number                |
|-----------------------------|----------------------------|
| 5VDC universal adaptor:     | AC1214                     |
| CO <sub>2</sub> calibrator: | CO <sub>2</sub> CALIBRATOR |

ROTRONIC AG, CH-8303 Bassersdorf  
Tel. +41 44 838 11 44, [www.rotronic.com](http://www.rotronic.com)  
ROTRONIC Messgeräte GmbH, D-76275 Ettlingen



**THORNE & DERRICK INTERNATIONAL**

Thorne & Derrick  
+44 (0) 191 490 1547  
[www.heatingandprocess.com](http://www.heatingandprocess.com)

Phone +44 1293 37 1000, [www.rotronic.co.uk](http://www.rotronic.co.uk)  
ROTRONIC Instrument Corp, NY 11788, USA  
Phone +1 631 427-3898, [www.rotronic-usa.com](http://www.rotronic-usa.com)  
ROTRONIC Instruments Pte Ltd, Singapore 159836  
Phone +65 6376 2107, [www.rotronic.com.sg](http://www.rotronic.com.sg)  
ROTRONIC Shanghai Rep. Offi ce, Shanghai 200233, China  
Phone +86 40 08162018, [www.rotronic.cn](http://www.rotronic.cn)